


Case history 6 using RTD embedded in the windings of the motor (con't)

Phase	7 th May 2008	11 th June 2008	10 th July 2008	30 th July 2008
Ch1 – Phase U	Pd activity of 1004mV	Pd activity of 1004mV	Pd activity of 1600mV	Pd activity of 1000mV
Ch2 – Phase V	No Pd activity	Pd activity of 490mV	Pd activity of 100mV	No Pd activity
Ch3 – Phase W	No Pd activity	No Pd activity	No Pd activity	No Pd activity

LEGEND :

■ Channel 1-Phase U
■ Channel 2-Phase V

■ Channel 3-Phase W
■ Channel 4 - Noise

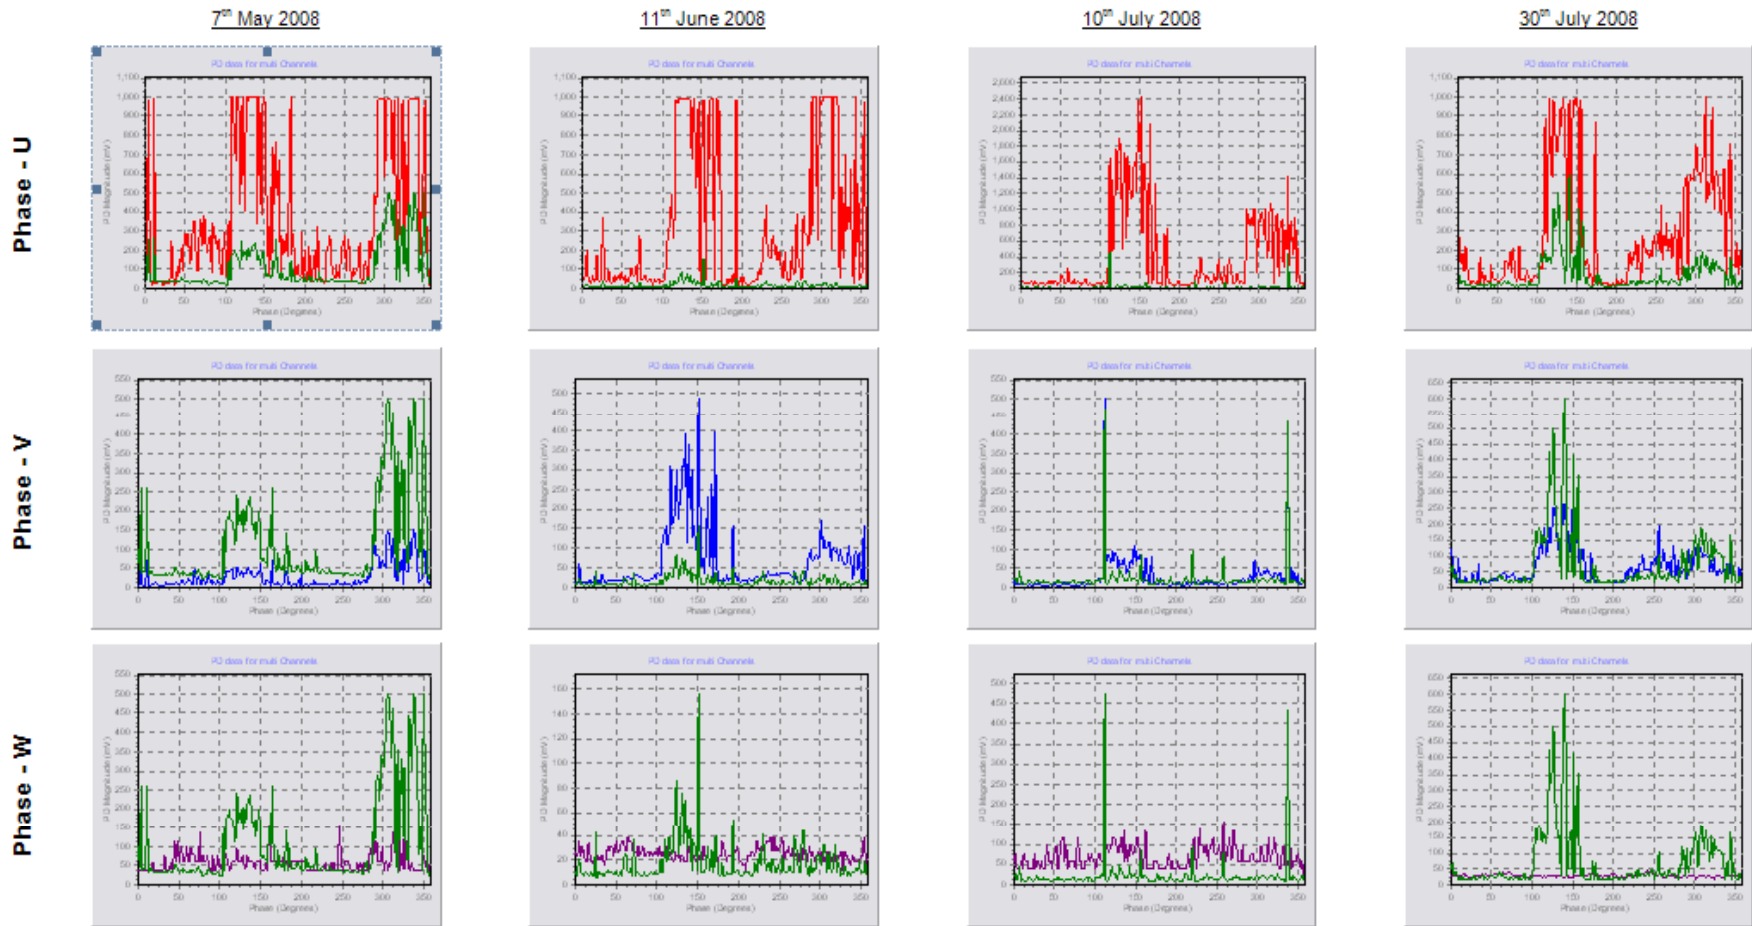

Case history 6 using RTD embedded in the windings of the motor (con't)



Glass tapes were found exposed on a few locations just outside the slot area due to peeling of corona tape.